

**Sedgwick County, Kansas – EMS Post #11  
Americans with Disabilities Act Transition Plan  
(1410 N. Rock Road - Derby)**

**December 2006**



Prepared by

**DMCG**  
**Disability Management Consulting Group L.L.C.**  
**(dba; ADA Accrediting and Consulting)**  
2801 Jonquil Place  
Columbia, MO 65202

In conjunction with

**Sedgwick County and the Wichita/Sedgwick County Access Advisory Board**

---

**Sedgwick County – ADA/504 Transition Plan – EMS Post #11 - December 2006**

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Parking	A van accessible parking space does not exist.	<a href="#">4.1.2(5)(a)</a> , <a href="#">(b)</a> , <a href="#">4.6</a>	If parking spaces are provided for self-parking by employees or visitors, or both, then accessible spaces complying with <a href="#">4.6</a> shall be provided in each such parking area in conformance with the table shown in <a href="#">(5)(a)</a> . In addition, ADAAG requires one in every eight accessible spaces, but not less than one, to be served by an access aisle 96 in (2440 mm) wide minimum and shall be designated "van accessible." The existing access aisle is too narrow to be designated as van accessible. <b>Modify the existing accessible parking space to conform to van accessible specifications. In addition, provide a "van accessible" sign mounted below the symbol of accessibility.</b>	L	L	M	<a href="#">5</a>	\$400	(See <a href="#">Building Block 1 – Accessible Parking</a> , for greater clarification).			
2. Public Unisex Restroom	The public unisex restroom is fully accessible except for the rear grab bar is slightly too high.	<a href="#">4.16.4</a>	According to ADAAG, grab bars at water closets are required to comply with <a href="#">Figure 29</a> and mounted between 33-inches and 36-inches high. <b>Modify the grab bar at the rear of the water closet so is mounted between 33-inches and 36-inches high.</b>	L	L	M	<a href="#">4</a>	\$100	See <a href="#">Building Block 9 – Accessible Restrooms</a> , for more information			

**EMS Post #11 - Transition Plan - Conceptual Cost Projections**

<b>Total</b>	<b>\$500</b>
<b>Year One (Very High – VH)</b>	<b>\$0</b>
<b>Year Three (High - H)</b>	<b>\$0</b>
<b>Year Five (Medium - M)</b>	<b>\$0</b>
<b>Year Ten (Low - L)</b>	<b>\$500</b>
<b>Year Ten (Very Low - VL)</b>	<b>\$0</b>