


**Sedgwick County, Kansas – EMS Post #12  
Americans with Disabilities Act Transition Plan  
(3320 N. Hillside)**

**December 2006**

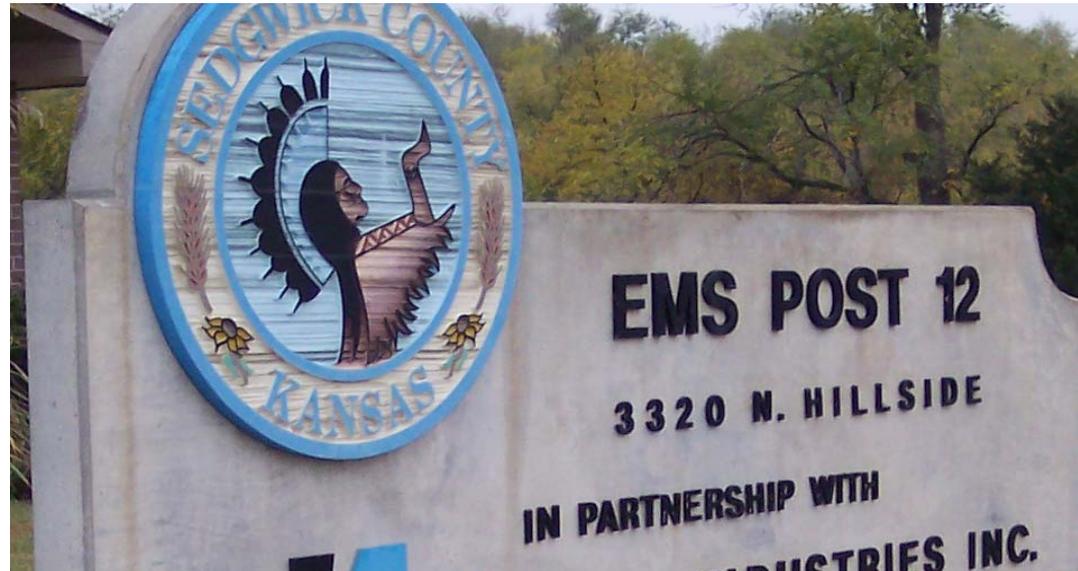

Prepared by

**DMCG**  
**Disability Management Consulting Group L.L.C.**  
**(dba; ADA Accrediting and Consulting)**  
2801 Jonquil Place  
Columbia, MO 65202

In conjunction with

**Sedgwick County and the Wichita/Sedgwick County Access Advisory Board**

---

**Sedgwick County – ADA/504 Transition Plan – EMS Post #12- December 2006**

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access			Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)			
1. Parking	The surface slope of the designated accessible parking space and access aisle is slightly too steep.	<a href="#">4.6.3</a>	The surface slope of accessible parking spaces and access aisles is generally beyond 2% and measures approximately 2.8%. ADAAG requires accessible parking spaces and access aisles to have surface slopes that do not exceed 2%. <b>Modify the existing accessible parking spaces or create other accessible parking at another location, which is still on the shortest path of travel to accessible entrances.</b>	V L	L	M	<a href="#">1</a> <a href="#">2</a>	\$4,000	(See <a href="#">Building Block 1 – Accessible Parking</a> , for greater clarification).						
2. Interior	The drinking fountain is not hi-lo.	<a href="#">4.15</a> <a href="#">4.1.3(10(a))</a>	According to ADAAG if only one drinking fountain is provided on a floor there shall be a drinking fountain which is accessible to individuals who use wheelchairs and one accessible to those who have difficulty bending or stooping. Cups at inaccessible drinking fountains are considered equivalent facilitation. <b>Provide a cup holder at this fountain and cane detection.</b>	L	L	M	<a href="#">3</a>	\$50	<a href="#">Building Block 7 – Drinking Fountains</a> <a href="#">ADA TAM 3 – Page 34</a>						
	Men and Women’s restroom / showers are fully accessible and comply with ADAAG specifications														

**EMS Post #12 - Transition Plan - Conceptual Cost Projections**

<b>Total</b>	<b>\$4,050</b>
<b>Year One (Very High – VH)</b>	<b>\$0</b>
<b>Year Three (High - H)</b>	<b>\$0</b>
<b>Year Five (Medium - M)</b>	<b>\$0</b>
<b>Year Ten (Low - L)</b>	<b>\$50</b>
<b>Year Ten (Very Low - VL)</b>	<b>\$4,000</b>