

**Sedgwick County, Kansas – Tag Office (Murdock)
Americans with Disabilities Act Transition Plan
(200 West Murdock)**

December 2006



Prepared by

DMCG
Disability Management Consulting Group L.L.C.
(dba; ADA Accrediting and Consulting)
2801 Jonquil Place
Columbia, MO 65202

In conjunction with

Sedgwick County and the Wichita/Sedgwick Access Advisory Board

Sedgwick County – ADA/504 Transition Plan – Tag Office (Murdock) - November 2006

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access			Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)			
1. Exterior	Van accessible parking signage does not exist at accessible parking.	4.1.2(5)(a) , (b) , 4.6	One in every eight accessible spaces, but not less than one, shall be served by an access aisle 96 in (2440 mm) wide minimum and shall be designated "van accessible." At least one of the existing accessible parking spaces has appropriate space to be designated van accessible. Provide a "van accessible" sign mounted below the symbol of accessibility at an existing accessible parking space, where the dimensions conform to ADAAG specifications.	M	H	M	57	\$1,000	(See Accessible Parking Detail – Attachment A and Parking Technical Bulletin , for greater clarification).						
2. Exterior	A sloping surface leads to the threshold of the Inspection Office entrance door, and the door has a high threshold.	4.13.6	ADAAG requires an approximate 5-foot by 5-foot level and clear space at non-power entrance doors. The required maneuvering area can have surface slopes not steeper than 1:50 in any direction. In addition, thresholds at doors that are required to be accessible can be no higher than ½-inch. Modify this door to comply with ADAAG specifications.	L ®	H	M	58	\$2,000	See Building Block 8 – Accessible Doors for more information regarding maneuvering space						
3. Interior	A hi-lo drinking fountain does not exist.	4.15.3	Cups at inaccessible drinking fountains are considered equivalent facilitation. Provide a cup holder at this fountain and a cane detectable area underneath.	H ®	H	M	63	\$200	ADA TAM 3 – P 34						
4. Interior	Braille signage at restroom entrance doors are in the wrong locations.	4.1.3(16) 4.30.4	Signs that identify permanent rooms and spaces (e.g. room numbers, restrooms, and exit signs) are required to be provided in Braille, mounted at 60-inches high measured to the center of the sign located at the latch side of the entrance door. Relocate Braille signage at restroom entrance doors to comply with ADAAG specifications.	V H	H	M	64	\$200	Signage Specifications for Permanent Rooms and Spaces						

Sedgwick County – ADA/504 Transition Plan – Tag Office (Murdock) - November 2006

Legend: Blue font identifies hyperlinked documents – Red font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access			Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)			
5. Interior	The entrance doors to both restrooms have heavy push/pull weights.	4.13.1 1	ADAAG requires that the maximum pressure required to push or pull open a door to be 5-pounds or less. These doors have automatic openers, but the automatic mechanism does not function. Repair the automatic features on each restroom entrance door.	V H	H	M	6 2	\$5,500	See Building Block 8 – Accessible Doors						
6. Interior	The entrance doors to both restrooms do not provide appropriate maneuvering space at the latch pull sides.	4.13.6	The existing entrance doors provide 2-inches of space at the latch pull sides. ADAAG requires at least 18-inches to the latch pull side of doors of this type, unless the doors are automatic. Repair the automatic features on each restroom entrance door.	V H	H	M	6 5	\$0	See Building Block 8 – Accessible Doors						
7. Interior	The intended accessible toilet stall, in the women’s restroom, is totally inaccessible due to numerous inconsistencies.	4.23	Inconsistencies include, inappropriate clear floor space, toilet is not centered at 18-inches, and no rear grab bar. Modify the restroom stall to comply with ADAAG specifications.	H	H	M	6 1	\$5,000	Restroom Figures – Building Blocks 9						

Tags Office (Murdock) - Transition Plan - Conceptual Cost Projections

Total	\$13,900
Year One (Very High – VH)	\$5,700
Year Three (High - H)	\$5,200
Year Five (Medium - M)	\$1,000
Year Ten (Low - L)	\$2,000
Year Ten (Very Low - VL)	\$0